
# lucent®

## ProSpex Edge90 Wallwash






92mm (3.62") overall diameter. Edge baffle to ensure aperture is glare free and for a professional look. Supplied with Shallow Height low output LED51 module. Available with standard trim kit or plaster-in kit for flush appearance. Family of matching products also available. Required depth height + 25mm^

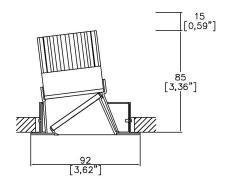

91413-WW-LED + 9000-PBZ Cut-out 83mm  $\varnothing$  Trim kit

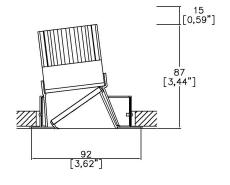

91413-WW-LED + 9000-PCZ Cut-out 83mm  $\varnothing$  Seamless flush appearance

Issued: 10/24

LED Source	LED51/2-SH
CCT	3000K
Drive Current	250mA
Power inc Driver	9.7W
Beam Angle	38°
Delivered Lumens	303
Delivered Intensisty cd	422
Efficacy Im/w	31
Forward Volt	33V
CRI	≥90 CRI

Apply these factors to 3000 K for lumen output of other CCTs:  $2200 \text{K} \times 0.65 / 2400 \text{K} \times 0.69 / 2700 \text{K} \times 0.98 / 4000 \text{K} \times 1.02$ .



Project Ref:		Location Ref:
Fixture Orc	ler Code: 91413-WW-LED -	
Fixture – 91413-WW-LED	Edge90 Wallwash with LED51	
Finish — WH BK RAL* ABR1 ABZ1 PCH1 PNK1 PBR1	White RAL 9010 Black RAL 9005 Custom RAL Colour* Antique Brass Antique Bronze Polished Chrome Polished Nickel Polished Brass	
IP Rating –	IP54	
Installation Order Code:		
Installation 9000-PBZ 9000-PCZ	Trim kit for trimmed appearance Plaster-kit for seamless flush appearan	ce
LED Order	Code: LED51/2 -	- 38 - SH-LO
LED LED51/2	LED50 ONE GEN2	
CCT 22*** 24*** 27 30 40***	90 CRI 2200K*** 90 CRI 2400K*** 90 CRI 2700K 90 CRI 3000K 90 CRI 4000K***	
Beam -	38°	
Shallow Height L	ow Output ent for availability	
Driver Options: Emergency Options:		
Protocol - S A P D B	Non-Dim Analogue (0-10v) Phase DALI Bluetooth**	Emergency E Maintained 3hr Emergency ED Maintained 3hr DALI Self Test ES Maintained 3hr Self Test

Issued: 10/24



### Finish selection



Antique Brass



Antique Bronze



Polished Brass



Polished Nickel



Polished Chrome

### Accessories



Honeycomb Louvre

Accessories Order Code:

Louvre/Lens LL45 Honeyo Honeycomb Louvre Warm Tone Lens UV Lens

Issued: 10/24



#### Technical Details

\*Custom RAL code must be specified. Custom RAL colours can increase prices and lead times

Dimming. Whilst Lucent can offer the majority of its luminaires with various dimming options, it remains the responsibility of the specifier/installer to check and ensure compatibility of any control equipment used. Additional cabling may be required depending on the dimming protocol specified.

- \*\*Bluetooth (wireless) is the communication method. The exact dimming protocol must be confirmed to allow the selection of suitable drivers or bluetooth devices.
- ^ Depth indicated is the minimum recess depth for the luminaire with a remote mounted LED driver. Installing a driver through either the luminaire cut-out or installation kit may require additional recess depth, please refer to the relevant luminaire installation instructions for further details. Data correct at time of publishing

First Fix Requirement. Luminaire comprised of fixture body with ceiling trim and installation kit, which is to be fitted into the ceiling once finished. Ensure correct alignment of the installation kit before final assembly (see luminaire instllation instructions for details)

IP Rating. Tested from underside of the ceiling

Note that the picture of the finishes provided is for illustrative purposes only. The finishes may vary in colour, texture and appearance. Contact Lucent lighting Ltd for more information.

It is the policy of Lucent Lighting to continually review and improve its products and therefore reserve the right to change any details of product or withdraw specifications without prior notice.

Luminaires designed to comply with EN60598 and all other standards.

This specification sheet supersededs all previous versions.

All intellectual property rights pertaining to the product described above and to this document are owned by or licensed to Lucent Lighting Ltd.

We reserve the right to take whatever action is necessary to protect those intellectual property rights.

Please notify Lucent Lighting Ltd of any inaccuracies immediately. E&OE

Issued: 10/24